



Fitting Instructions for 1/2" Corrugated Hardline Connectors N Type Male

For cable type LDF4-50 and similar 1/2" corrugated coaxial cables


Prepare cable by cutting the end squarely then trim back outer jacket and remove approximately 30 mm, ensuring the jacket is trimmed from the centre of a valley

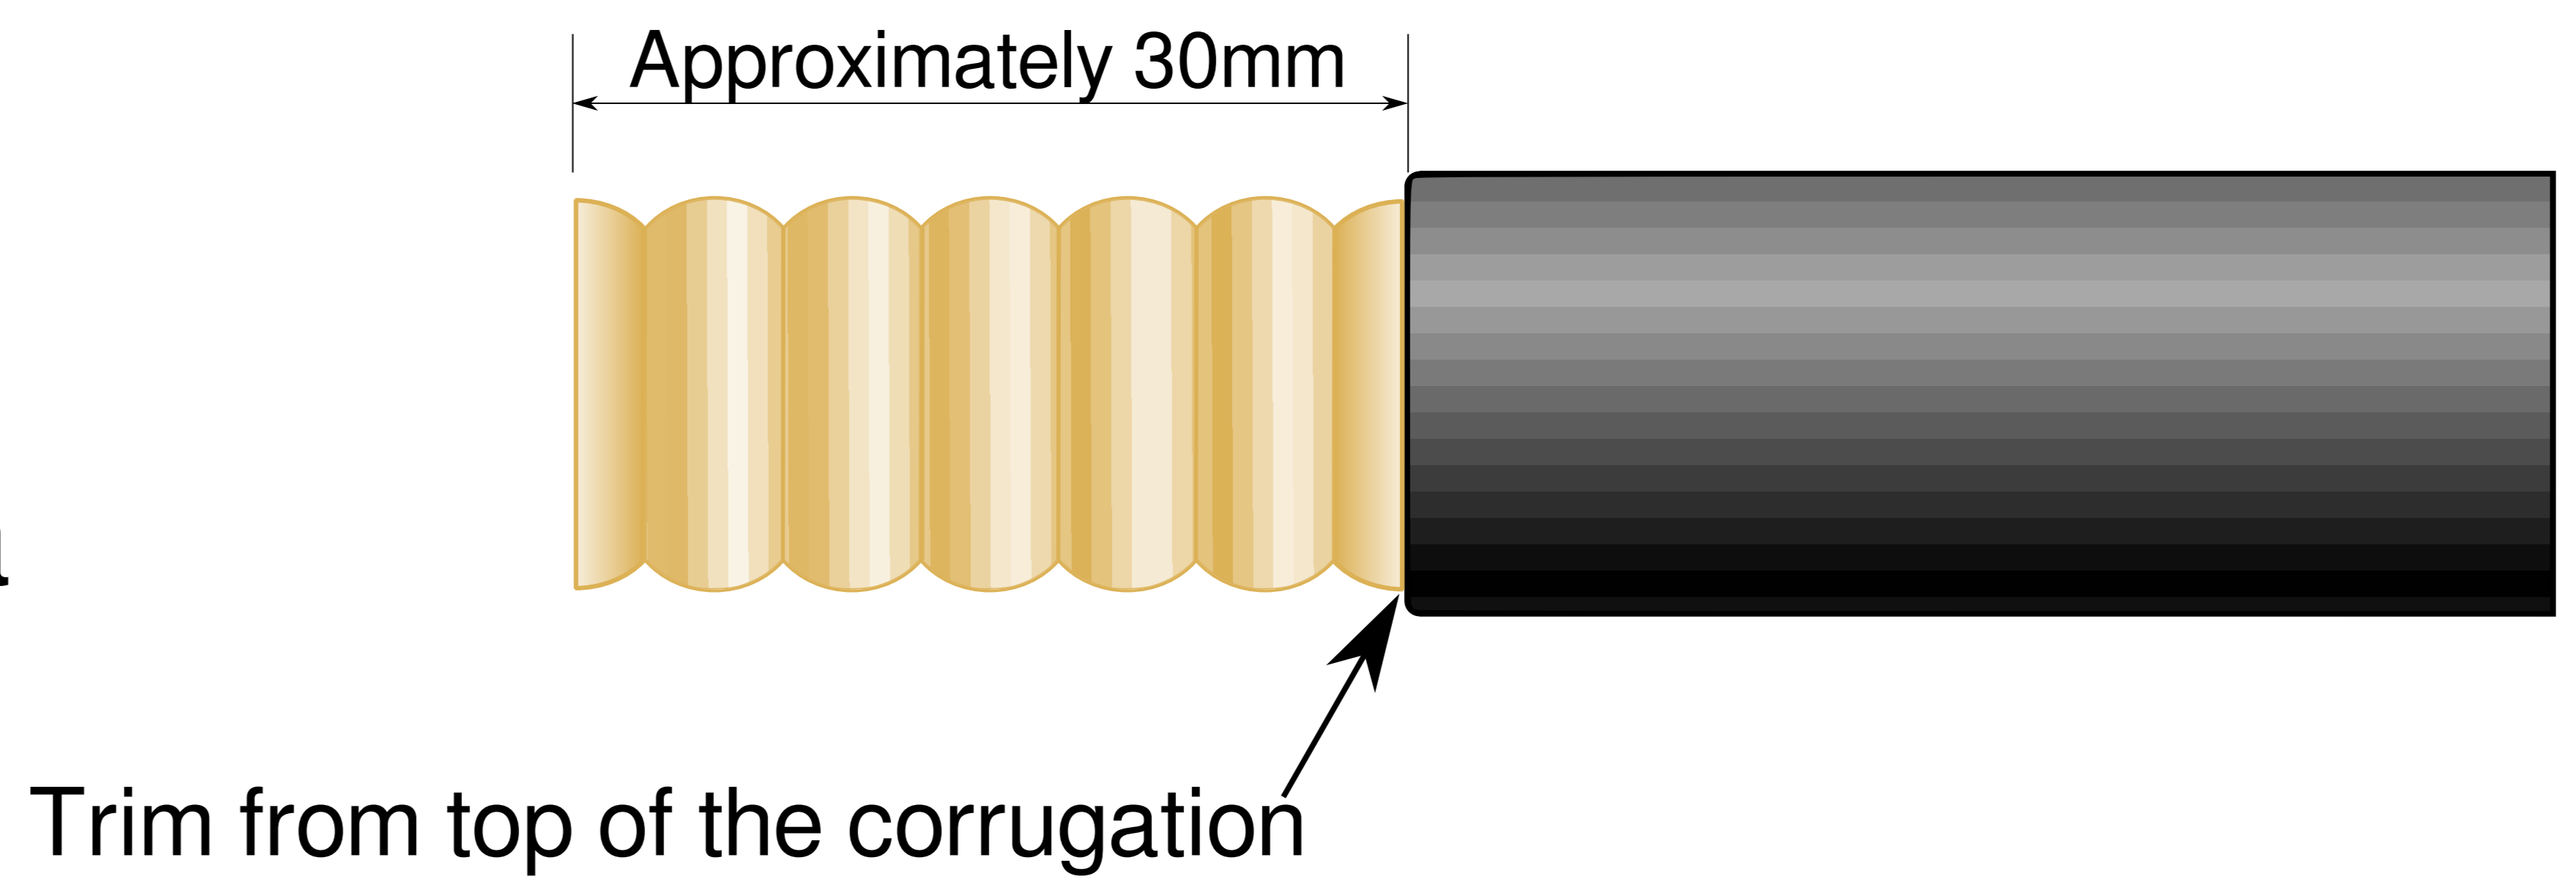


Fit the rubber O ring over the cable screen, flush with the cable jacket

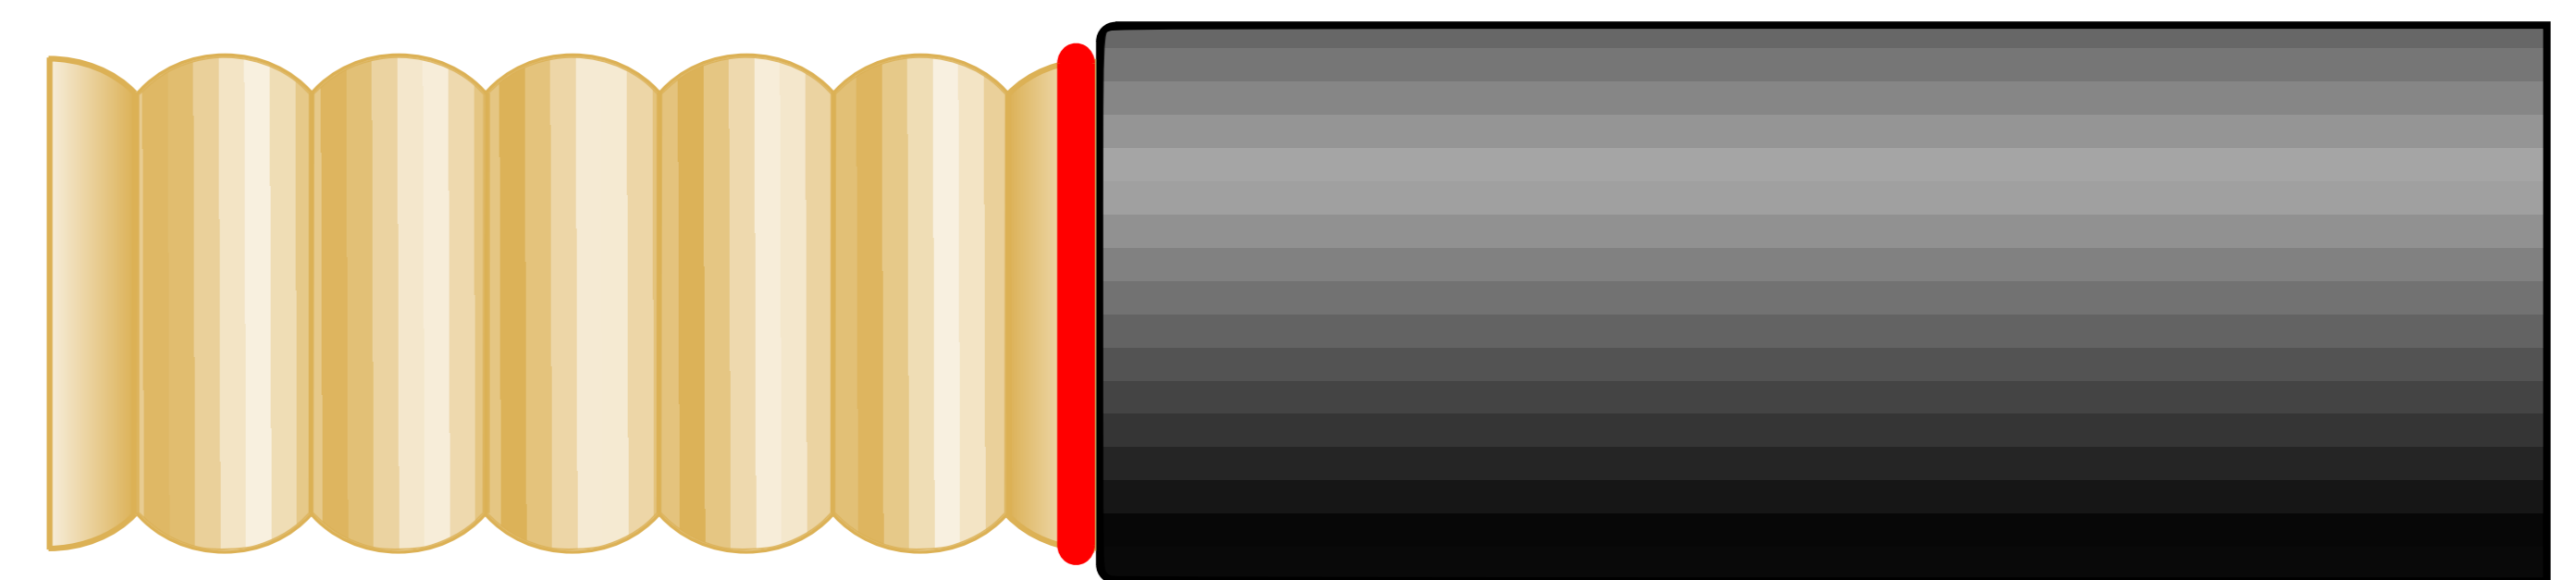

With a sharp knife, trim the copper screen at the top of the corrugation so that 15mm is remaining. Remove the screen and dielectric being careful not to cut the centre conductor.

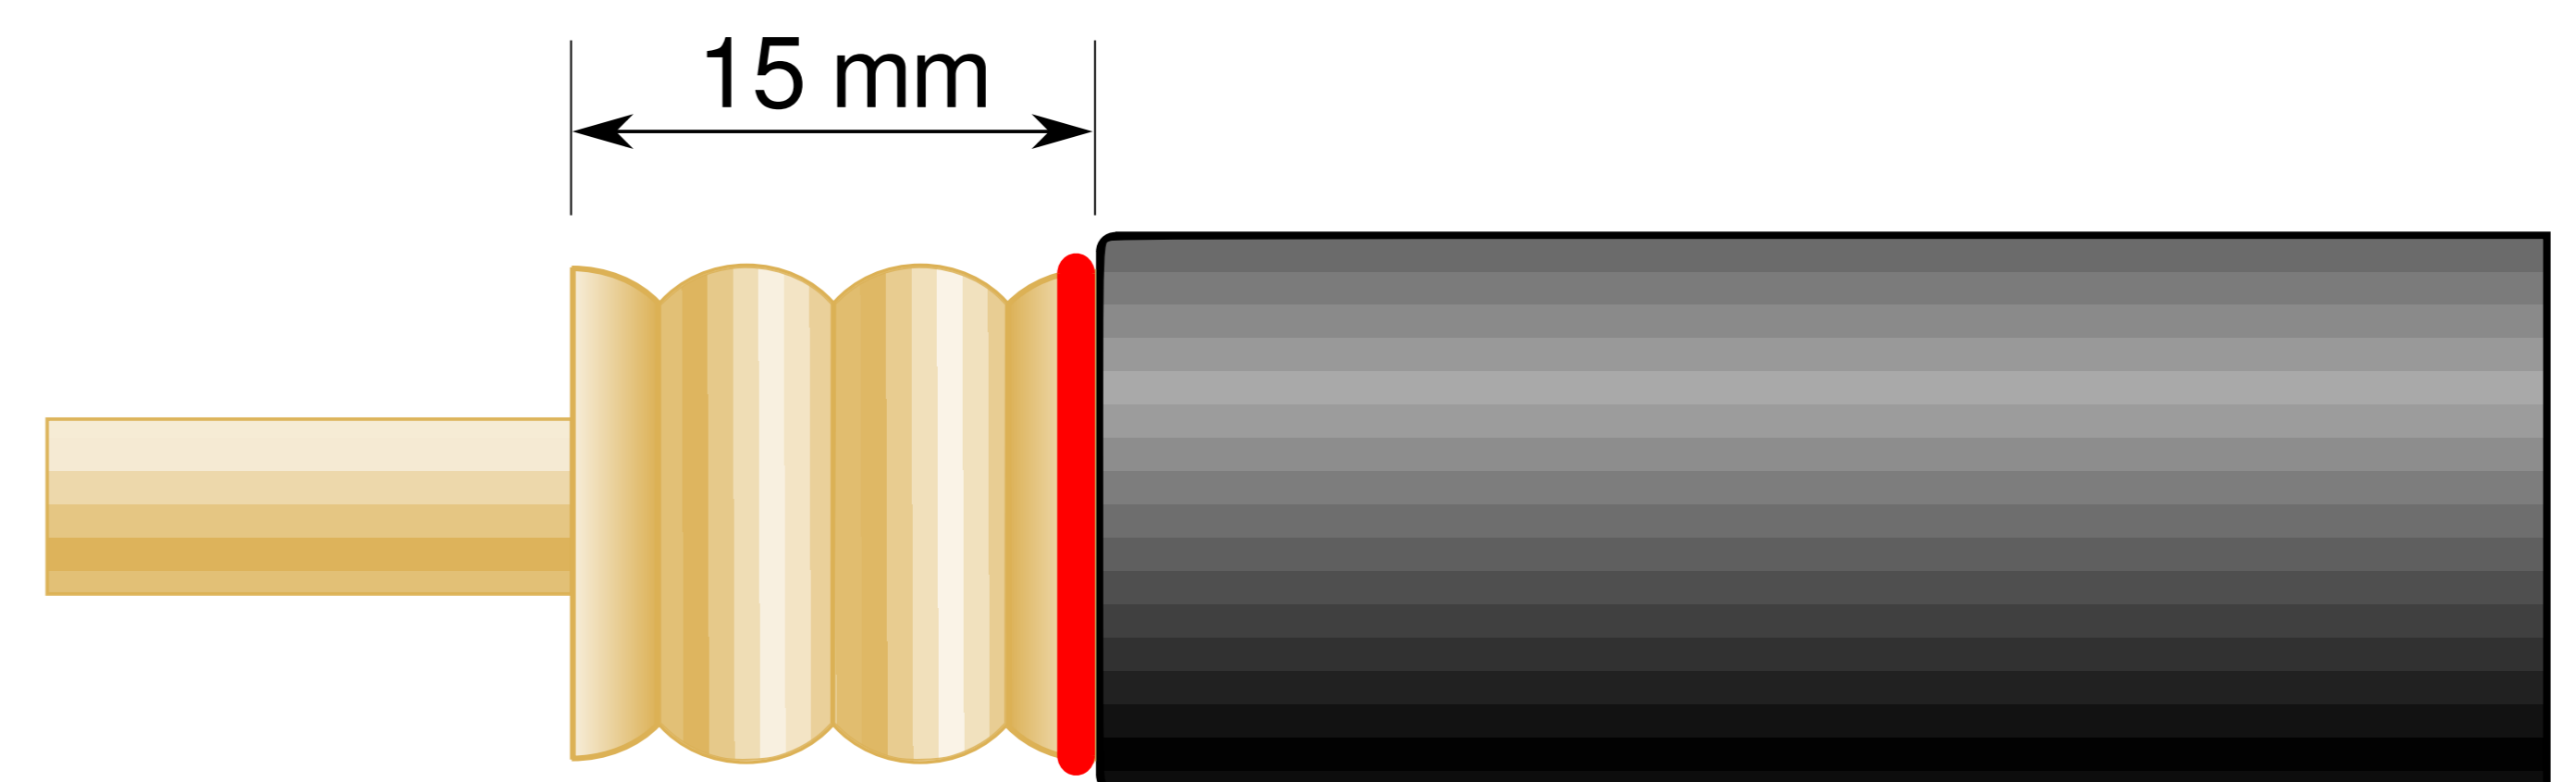


Cut the centre conductor so that 10mm is protruding from the dielectric. Ensure the end of the centre conductor is flat and clean of any debris or dielectric material

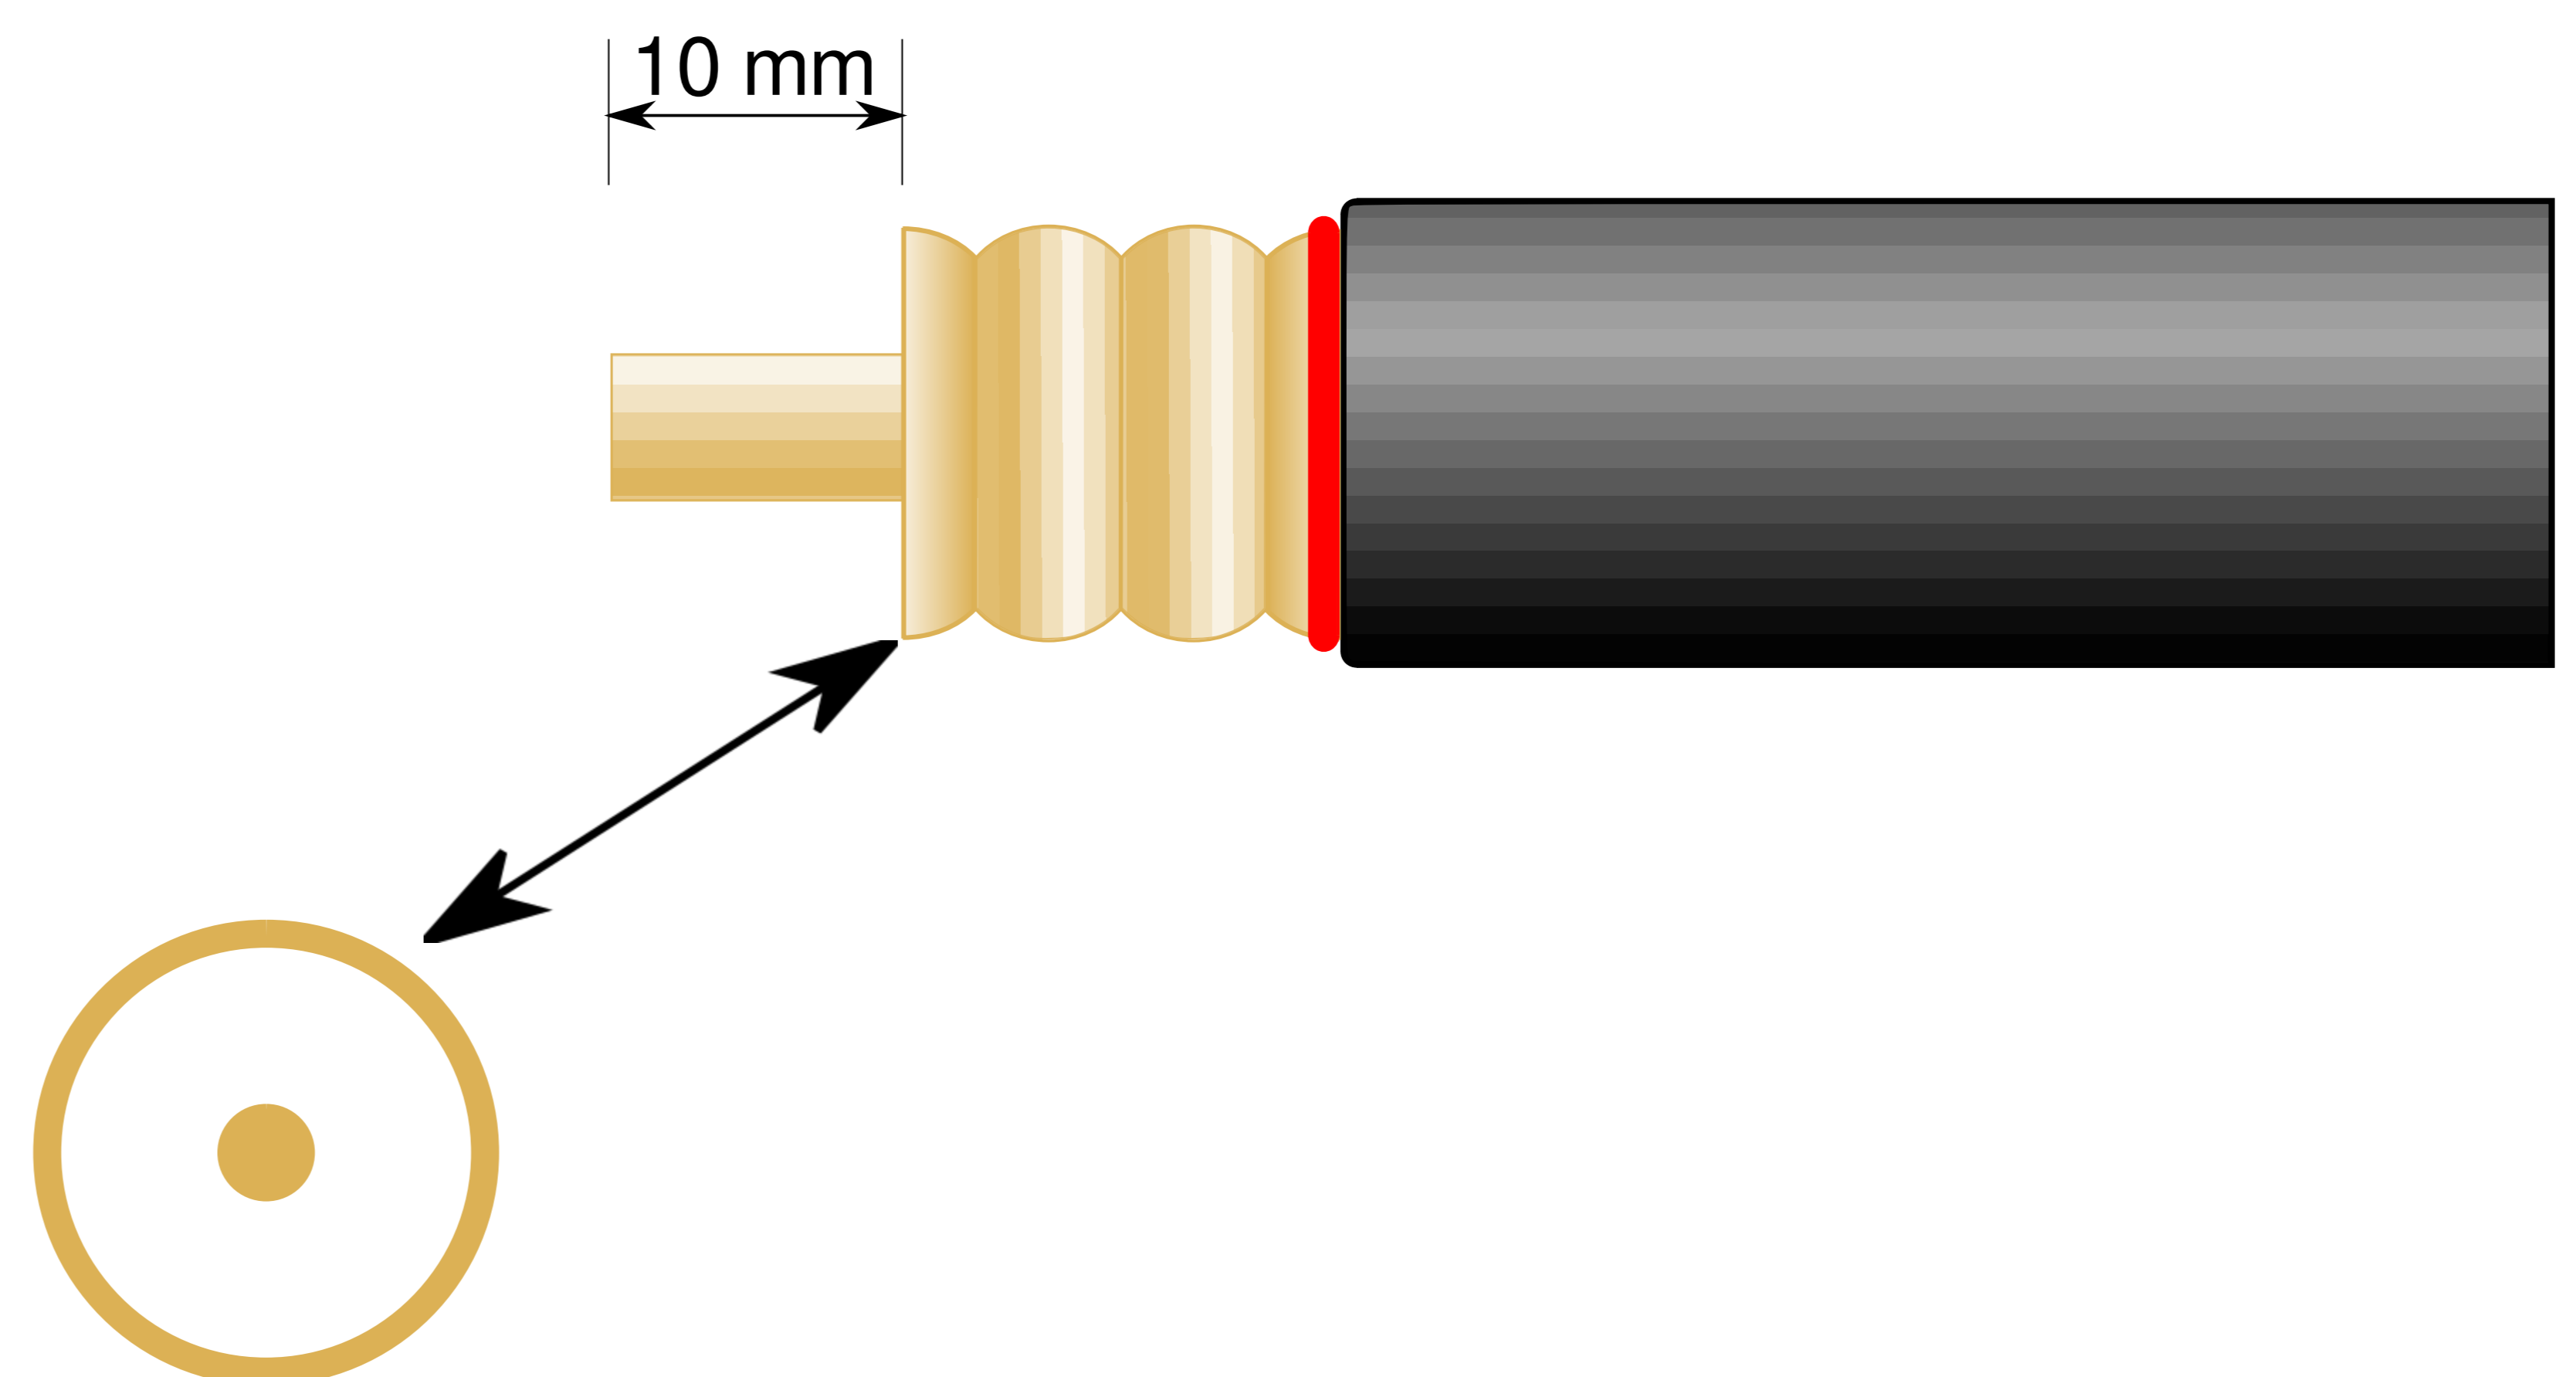

Inspect the end of the copper screen, if it is deformed, straighten with a small screwdriver, or a flaring tool if available

Firmly push the locking nut onto the cable, ensuring that the finger stock is seated in a valley of the cable screen

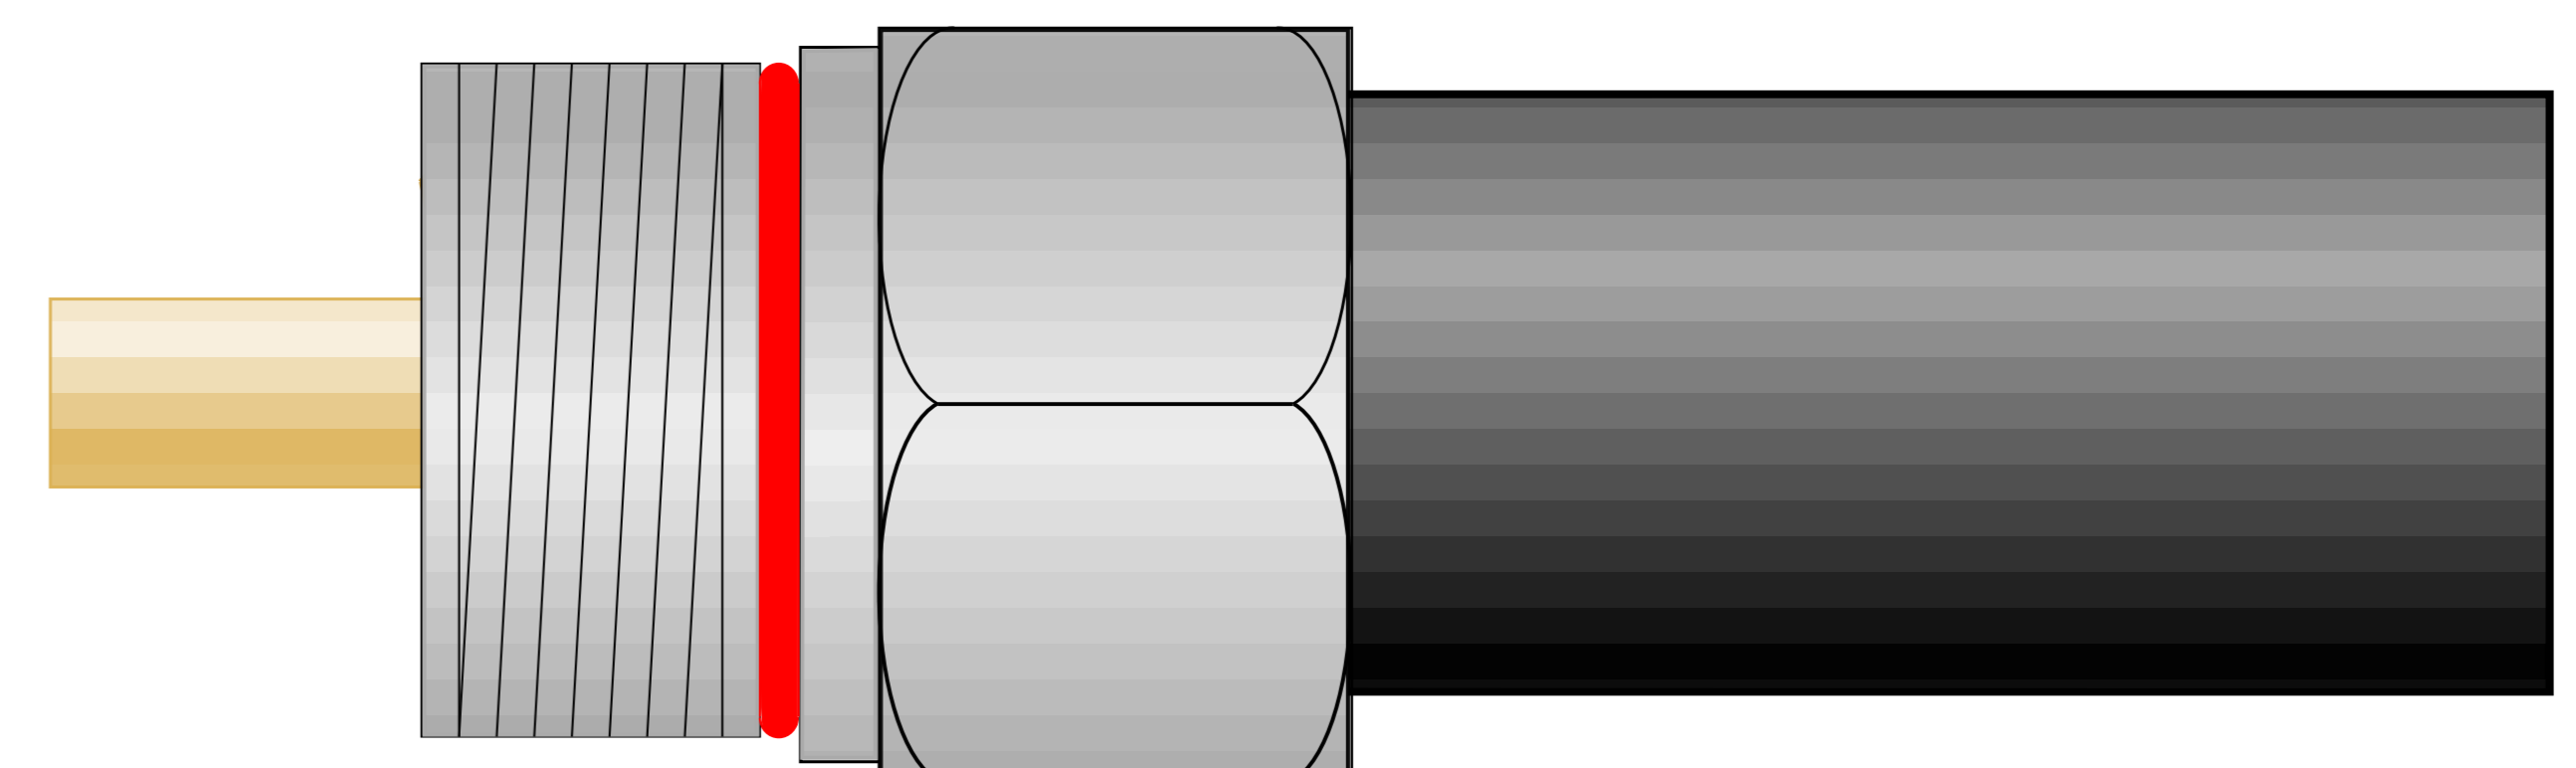

With two spanners, hold the locking nut stationary and tighten the connector body onto the locking nut

