



Fitting Instructions for 1/2" Corrugated Hardline Connectors N Type Male

For cable type LDF4-50 and similar 1/2" corrugated coaxial cables


Prepare cable by cutting the end squarely then trim back outer jacket and remove approximately 30 mm, ensuring the jacket is trimmed from the centre of a valley

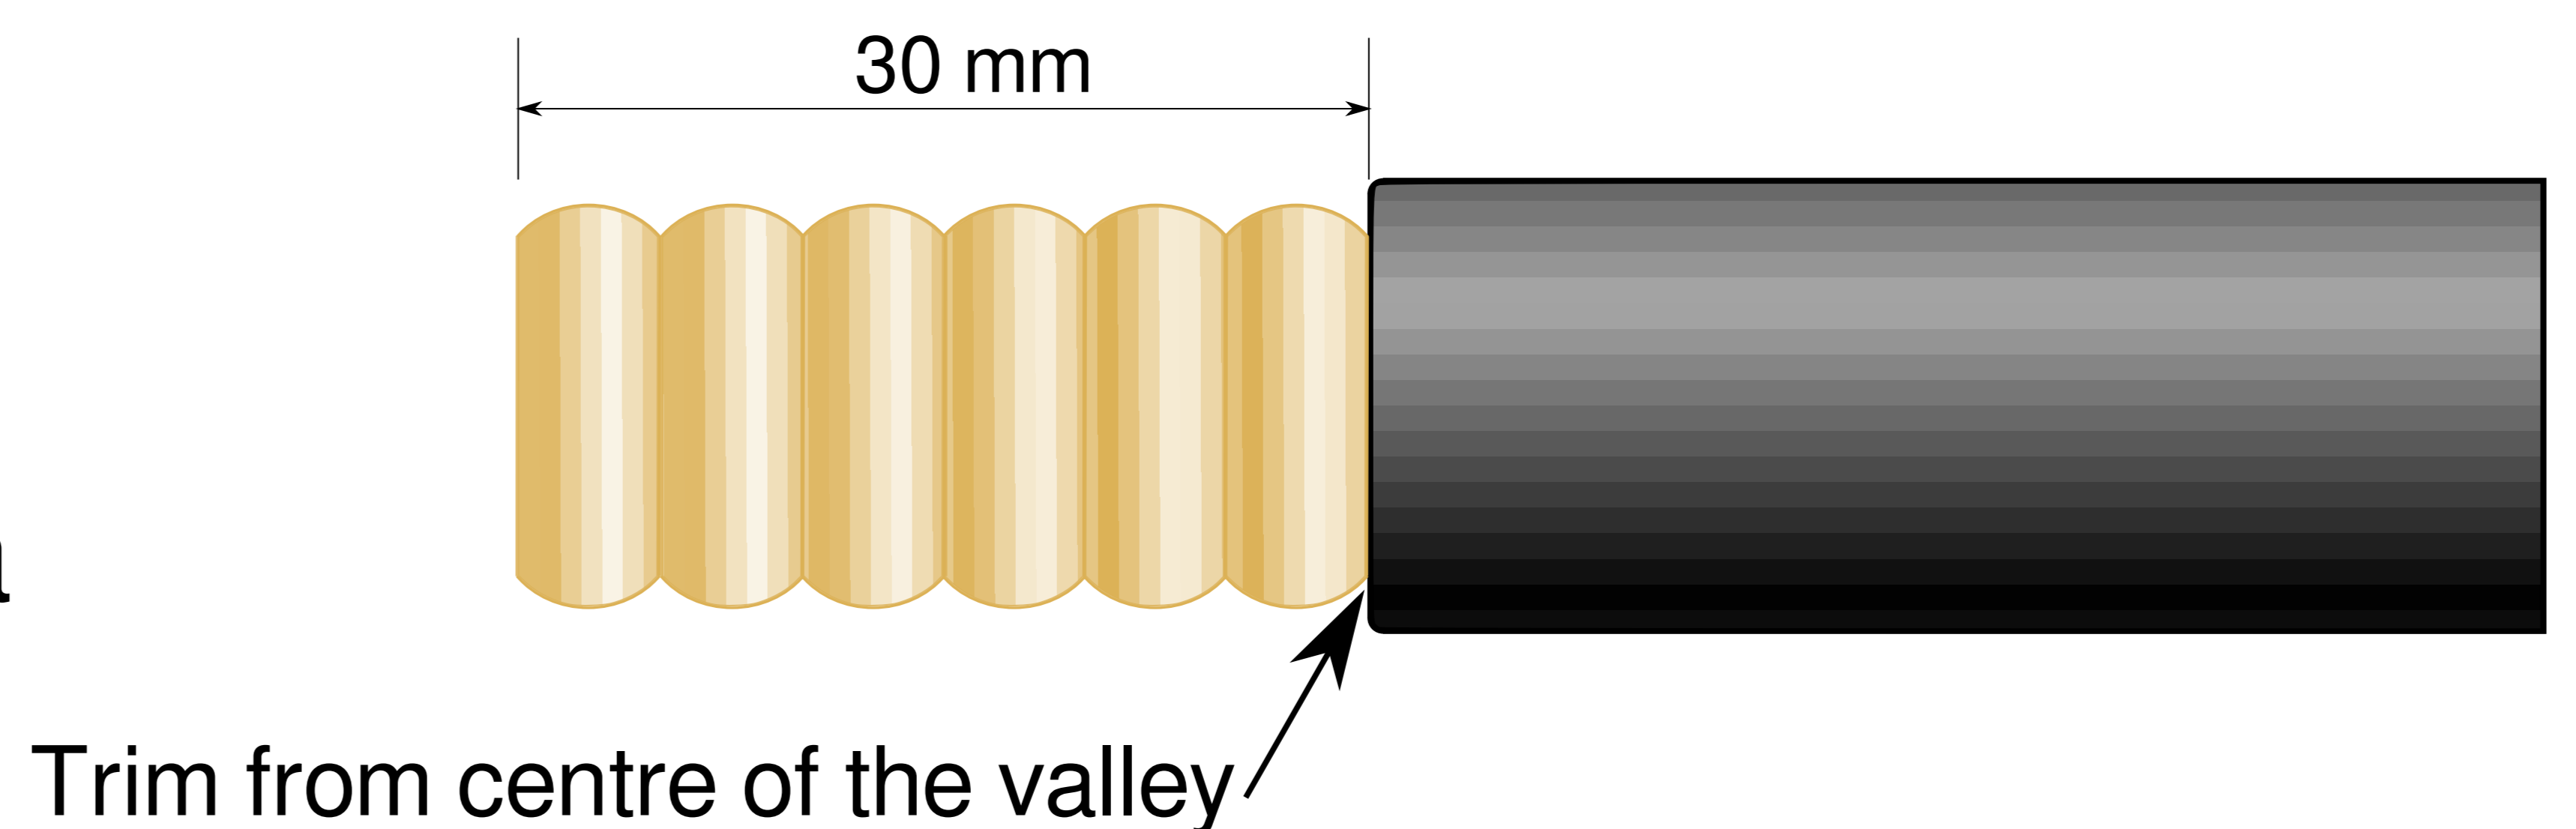


Fit the red waterproof gasket over the cable outer screen, flush with the cable jacket

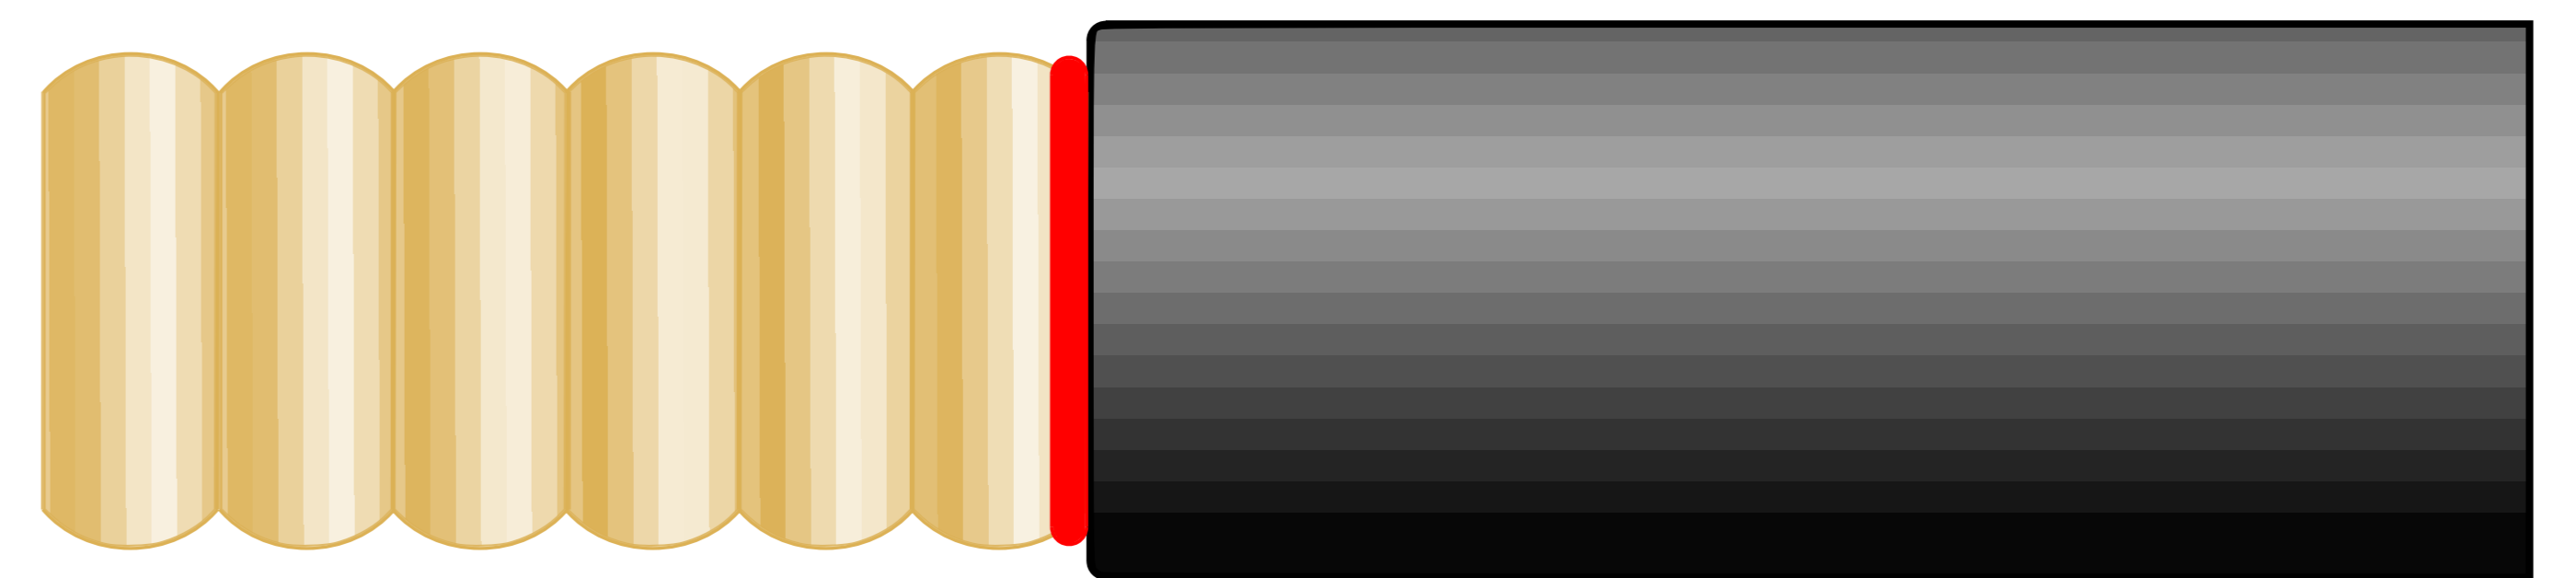


With a sharp knife, trim the copper screen and dielectric foam so that 15mm is remaining

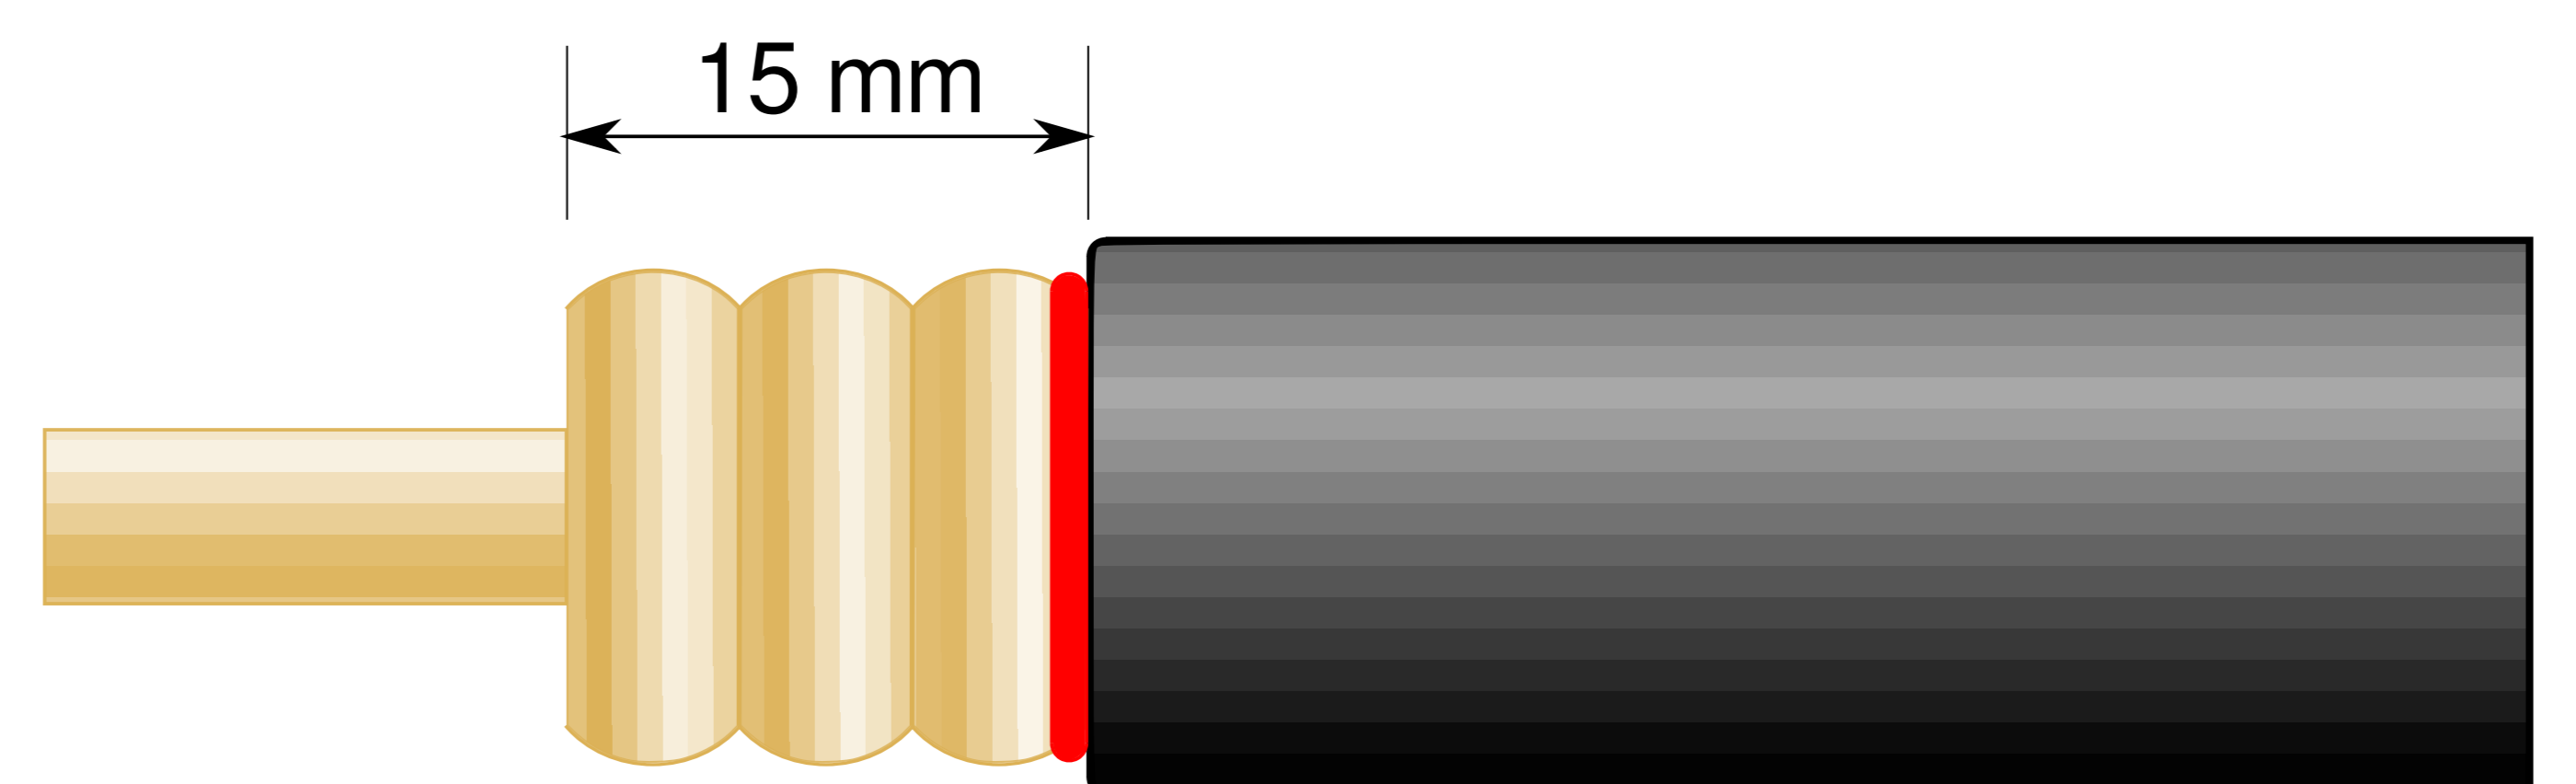

Cut the centre conductor so that 10mm is protruding from the dielectric. Ensure the end of the centre conductor is flat and clean of any debris or dielectric material

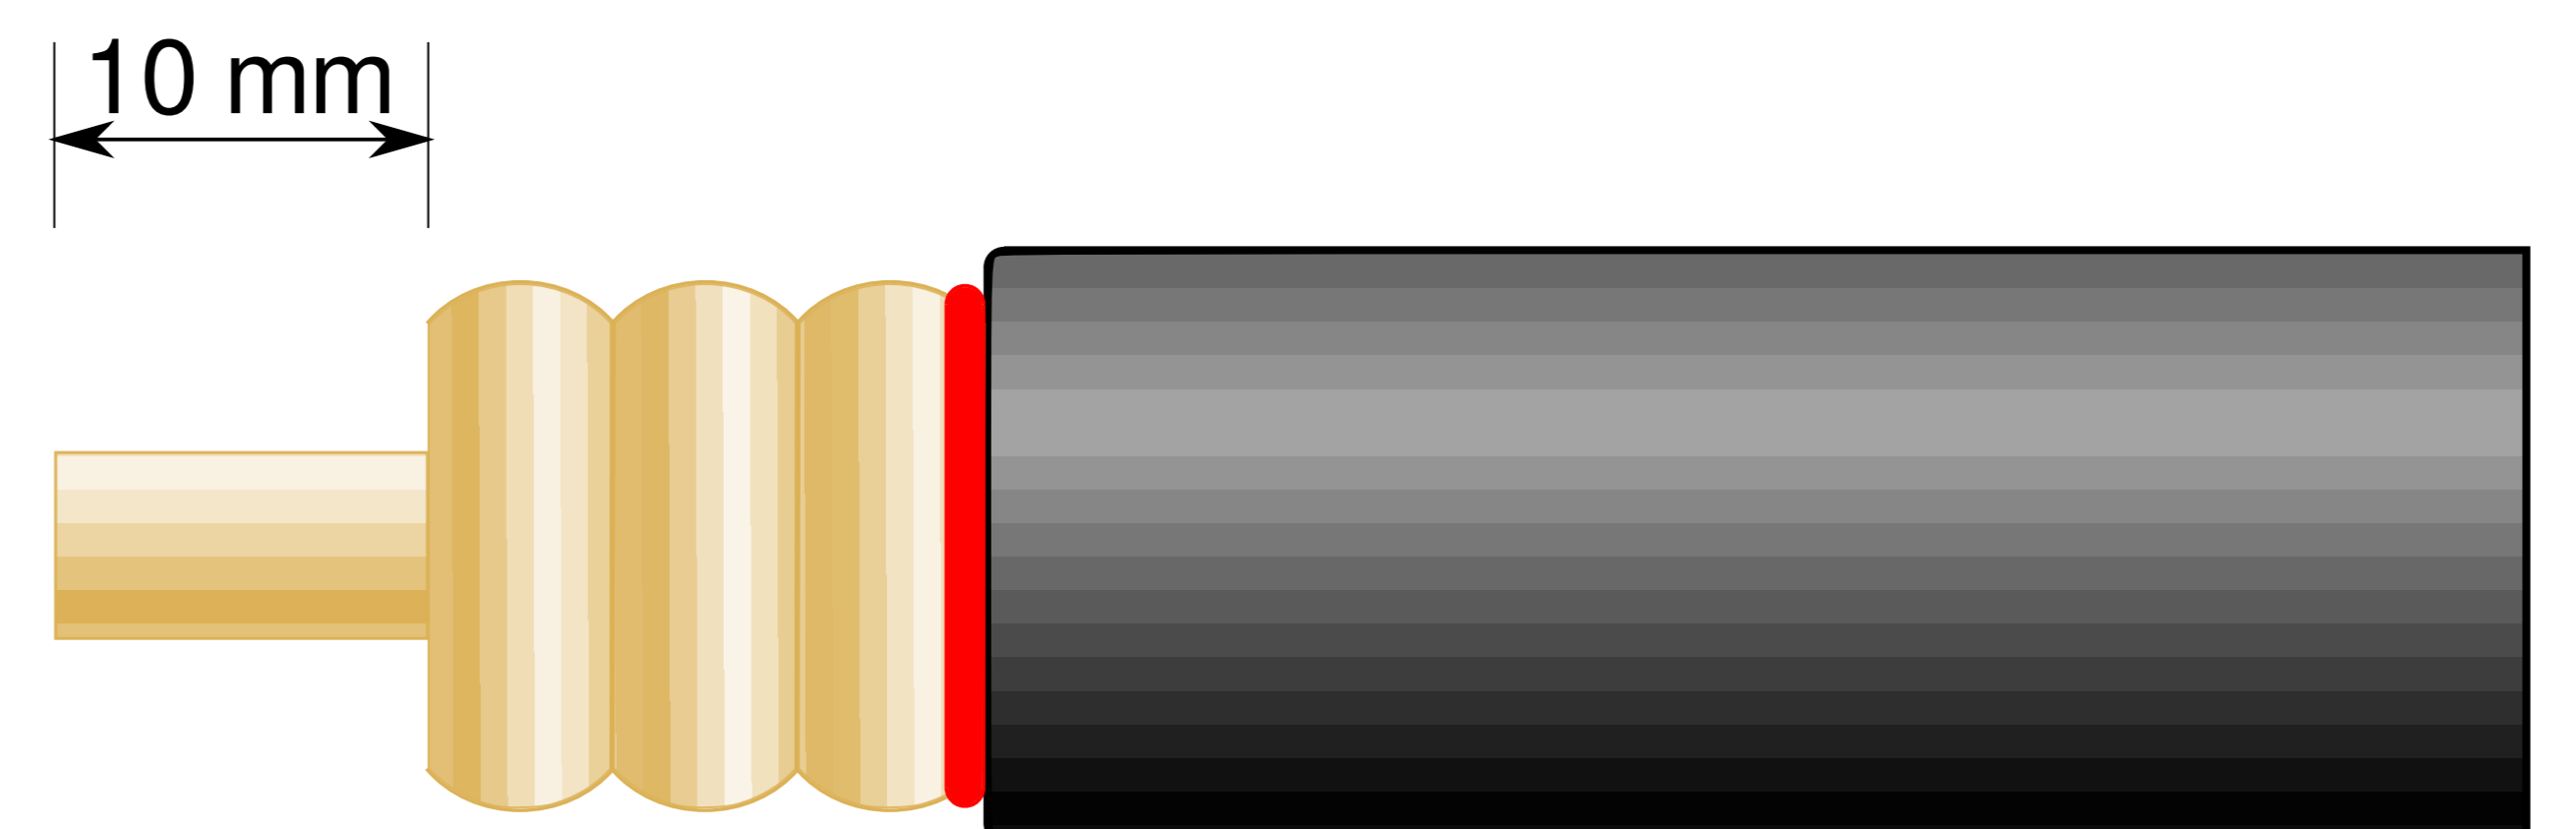

Firmly push the locking nut onto the cable, ensuring that the finger stock is seated in a valley of the cable screen

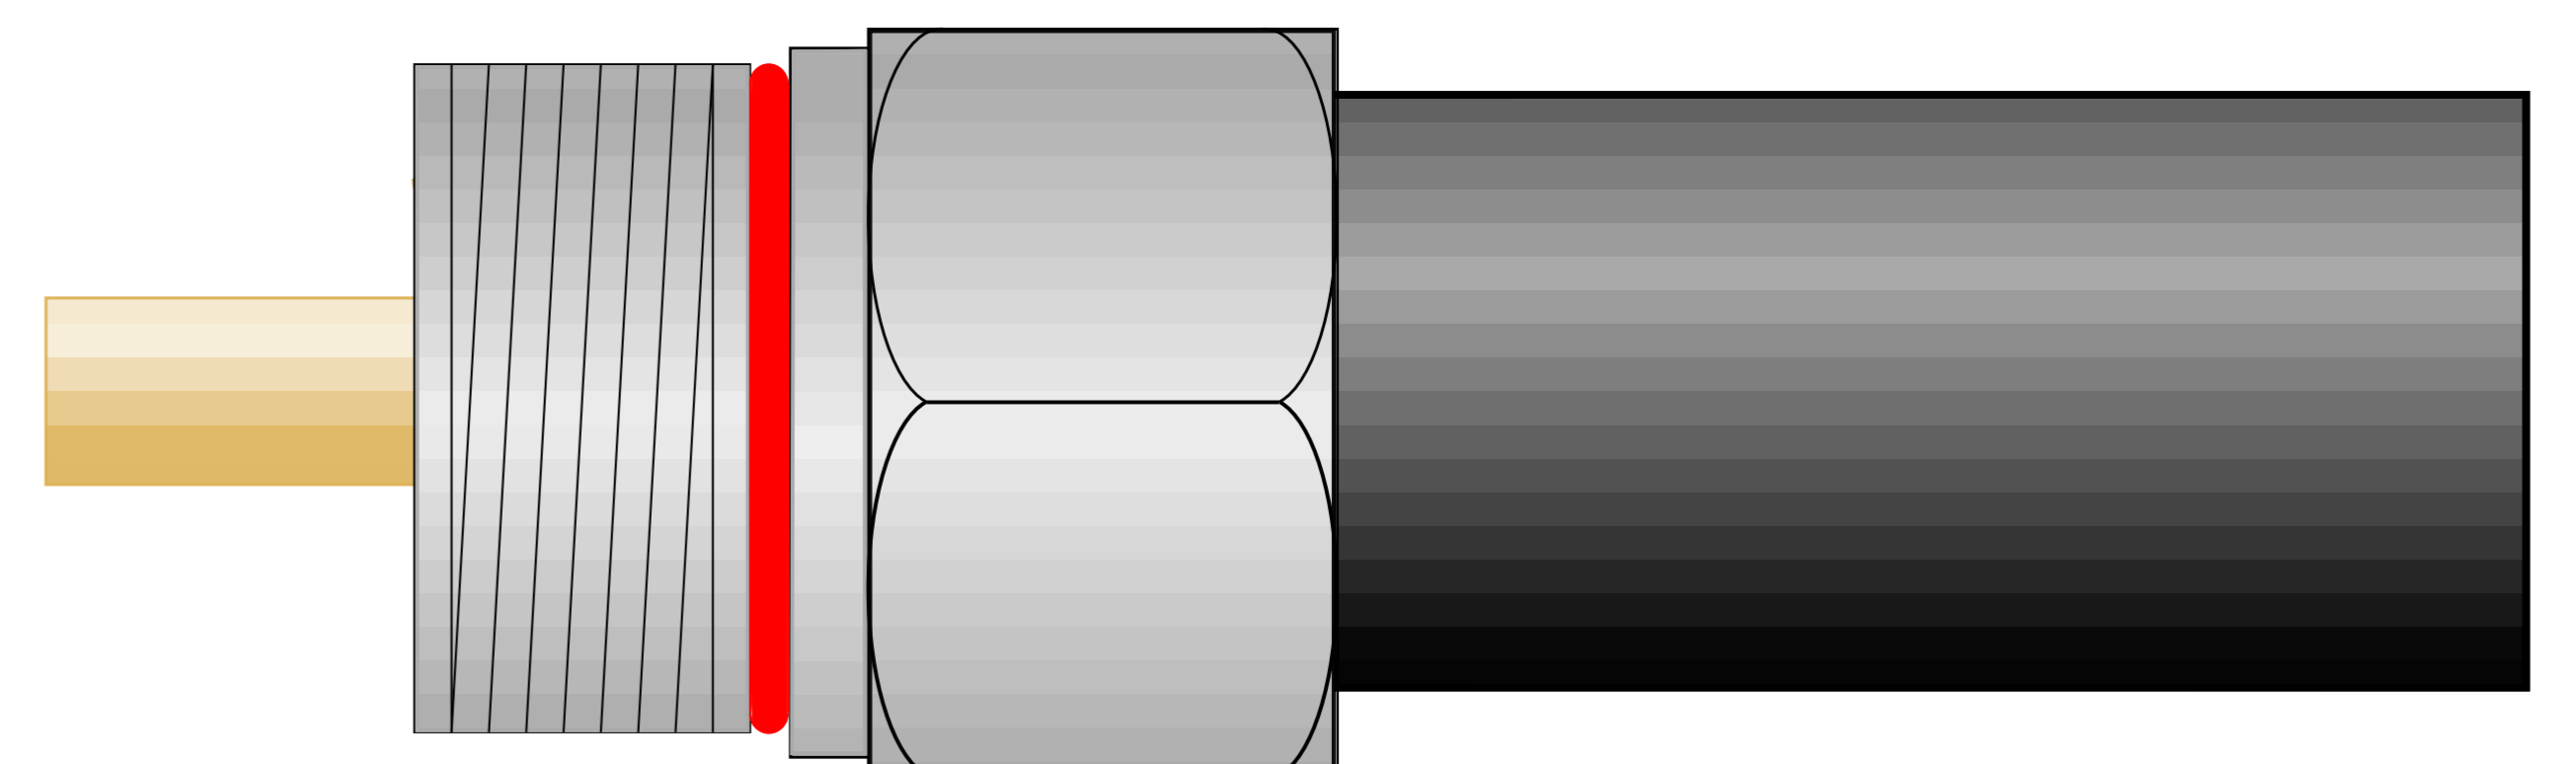

With two spanners, hold the locking nut stationary and tighten the connector body onto the locking nut

